

Illustrated Parts List - IPL Update



Product Name(s)

H545/545G Mark II

Description of change

1. New Ball Bearing 525 43 42-04, with new material for improved durability.
2. A new Clutch assy, 577 51 82-02 has been implemented with higher engaging rpm.
3. We have changed number on Ignition Module due to that a new shrink tube has been added to hold the cables in place.

Comments

These changes are interchangeable.

Introduced from


| Serial number / Date | Remark |
|----------------------|---|
| s/n 20203200001 | Valid for Ball bearing, Crankcase, Crankshaft and Shortblock. |
| s/n 20201500336 | Valid for Clutch assy 577 51 82-02. |
| s/n 20203700001 | Valid for Ignition Module 582 77 73-03. |

IPL updates

| Page Title | Ref. no | New part no | Name | Excl. part no. | Remark |
|-------------------|---------|--------------|-----------------|----------------|--------|
| Crankcase | 9 | 595 89 77-02 | Crankcase Kit | 595 89 77-01 | |
| Crankshaft | 1 | 596 21 85-02 | Crankshaft Kit | 596 21 85-01 | |
| | 3 | 525 43 42-04 | Ball Bearing | 525 43 42-03 | |
| Clutch & Oil pump | 3 | 577 51 82-02 | Clutch assy | 577 51 82-01 | |
| Ignition system | 1 | 582 77 73-03 | Ignition Module | 582 77 73-01 | |
| ShortBlock | 1 | 595 94 50-04 | Shortblock | 595 94 50-02 | |


3. Ignition module

New version.

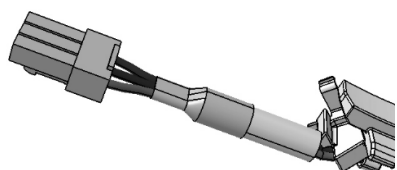

582 77 73-03

Old version.

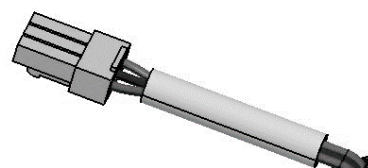

582 77 73-01

