

Illustrated Parts List - IPL Update



Product Name(s)

H555

Description of change

1. New Carburetor, kit 501 46 33-04 added. New angle on fuel nipple.
2. New Fuel hose 577 50 41-01 is 26 mm shorter than old 573 99 35-03 to fit new connection on Carburetor.
3. Choke control changed to secure correct assembly.

Comments

This update is fully exchangeable.

Introduced from


Serial number / Date	Remark
s/n 20161300001	New Carburetor ZAMA140056A.
s/n 20161000481	Valid for Fuel hose 577 50 41-01.
s/n 20153900097	Valid for Choke control 510 01 72-02.

IPL updates

Page Title	Ref. no	New part no	Name	Excl. part no.	Remark
Carburetor & details	1	501 46 33-04	Carburetor kit	579 19 41-08	With new Fuel hose 577 50 41-01.
Carburetor & air filter	4	510 01 72-02	Choke control	510 01 72-01	
	10	501 46 33-04	Carburetor kit	579 19 41-08	With new Fuel hose 577 50 41-01.
Fuel tank	24	577 50 41-01	Fuel hose		

2. Fuel hose, Instruction.

When you don't want to change to the new fuel hose included in kit, Carburetor.
Cut your old hose like this:

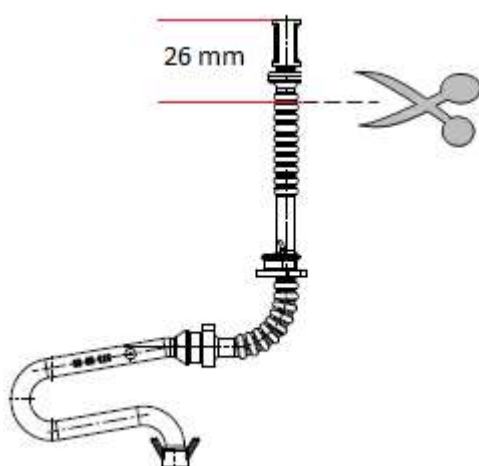

537 99 35-03

3. Choke control.



510 01 72-02



510 01 72-01