

# Illustrated Parts List - IPL Update



Product Name(s)

**365 X-TORQ**

Description of change

1. New Ignition module. New start curve. This update together with the new decompression valve improve startability of hot product and/or avoid misfire
2. New decompression valve to cylinder. Hole Ø1mm was Ø1.2mm
3. New tank cap and gasket. Reason is new supplier

Comments

Fully interchangeable  
To improve startability of hot product and/or avoid misfire we recommend changing both ignition module and the decompression valve.

Introduced from

Serial number / Date	Remark
20163500769 -	Ignition module 588 93 74-03
20163500769 -	Decompression valve 584 28 87-01
20163200001 -	Tank cap assy 537 21 52-07
20163200001 -	Gasket, tank cap 589 24 11-01

IPL updates

Page Title	Ref. No	New part no	Name	Excl. part no.	Remark
Ignition system	16	588 93 74-03	Ignition module	586 88 03-03	
Cylinder piston	4	584 28 87-01	Decompression valve	537 29 44-01	
Fuel tank	14	537 21 52-07	Tank cap assy	537 21 52-02	
	16	589 24 11-01	Gasket, tank cap	537 21 50-01	
Crank case	30	537 21 52-07	Tank cap assy	537 21 52-02	
	32	589 24 11-01	Gasket, tank cap	537 21 50-01	

## 1. Ignition module




588 93 74-03




586 88 03-03

# Illustrated Parts List - IPL Update

## 2. Decompression valve

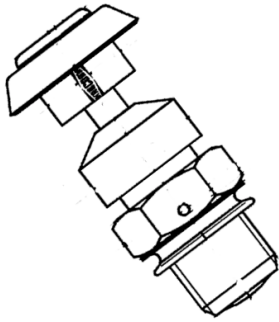


584 28 87-01

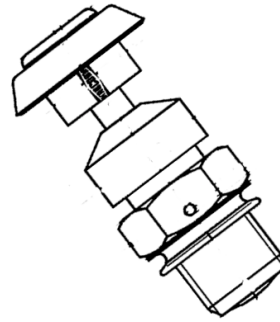


537 29 44-01

## 3. Tank cap assy

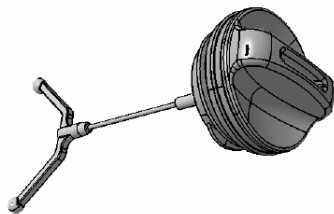

537 21 52-07

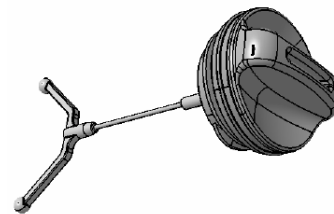

537 21 52-02

## 4. Gasket, tank cap



589 24 11-01



537 21 50-01