

Illustrated Parts List - IPL Update



Product Name(s)

H465RII

Description of change

1. New Ignition module, assy : 586 81 50-02 was 575 67 37-02. Minor correction.
2. New improved Fuel tank ventilation 501 15 29-01 added on crankcase 575 39 26-03. Tank ventilation improved regarding higher opening pressure.
3. New Tank cap assy and gasket number due to change of supplier. Minor correction.
4. Choke control changed to secure correct assembly.

Comments

This update is fully exchangeable.

Introduced from

Serial number / Date	Remark
s/n 20154400001	Choke control assy.
s/n 20164300001	Crankcase and fuel tank ventilation

IPL updates

Page Title	Ref. no	New part no	Name	Excl. part no.	Remark
Carburetor & air filter	5	510 01 72-02	Choke control assy.	510 01 72-01	
Crankcase	15	501 15 29-01	Tank vent assy	537 35 95-01	
	19	575 39 26-03	Crankcase	575 39 26-01	
Fuel tank	7	522 62 00-03	Tank cap assy.	522 62 00-01	Minor correction.
	9	589 24 11-01	Gasket	537 21 50-01	Minor correction.
Ignition system	6	586 81 50-02	Ignition module	575 67 37-02	Minor correction.

Illustrated Parts List - IPL Update



5. Choke control


New version



510 01 72-02



Old version

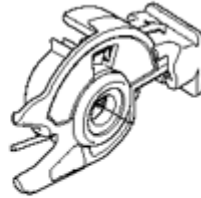

510 01 72-01